# **Tips & Tricks**

# General

Here you will find information about general issues concerning the operation of the RepRap Industrial in your specific work environment.

#### Commandline Access to the linux operating system via SSH

Use SSH on your computer connected to the same LAN as your 3D printer to log in to the RepRap Industrials' built-in BeagleBone Black. You can use the hostname from the printers' Backend-URL and log in with the following access data:

User: kiosk Password: eight-digit combination from the serial number at the back of the device. Take the first two four-digit blocks - XX-AAAA-BBBB-CCCC-YYYY becomes an "AAAABBBB" password.

#### Setting a static IP address for RepRap Industrial ethernet connection

First, establish a commandline connection to the printer.

From within the terminal session, edit the network configuration via the command line editor "nano"

```
sudo nano /etc/network/interfaces
(use the same password as for the SSH connection)
```

The current DHCP setup looks like:

```
# The primary network interface
auto eth0
iface eth0 inet dhcp
pre-up iptables-restore </etc/iptables.rules</pre>
```

Change the setup according to your needs. Example:

```
# The primary network interface
auto eth0
iface eth0 inet static
address 192.168.1.20
netmask 255.255.255.0
network 192.468.1.0
broadcast 192.168.1.255
gateway 192.168.1.254
dns-search family.local
```

dns-nameservers 192.168.1.254
 pre-up iptables-restore </etc/iptables.rules</pre>

The rest of the file remains unchanged. Save the file using CTRL+X and confirm the overwrite query with "Y". Disconnect and finish by typing

exit

Shut down (see Manual control) and reboot (power-on button, 11 in fig. 4) the RepRap Industrial to establish the alterations.

#### Use a custom NTP server for time signals

First, establish a commandline connection to the printer.

From within the terminal session, stop the NTP daemon background process

sudo service ntp stop
(use the same password as for the SSH connection)

Edit the NTP daemon configuration via the command line editor "nano"

sudo nano /etc/ntp.conf

Search for the few lines beginning with

server ...

and add an additional new line before these with the address to your local NTP server like this

server 192.168.1.123

add another additional statement anywhere in this file

```
# ignore panic threshold for huge time differences tinker panic \boldsymbol{0}
```

The rest of the file remains unchanged. Save the file using CTRL+X and confirm the overwrite query with "Y".

Re-enable NTP client service for background operation

sudo service ntp start

Disconnect and finish by typing

exit

Shut down (see Manual control) and reboot (power-on button, 11 in fig. 4) the RepRap Industrial to

establish the alterations.

## Changing Shell Password in the BeagleBone Black Operating System

After manually creating a new Micro-SD Card from a pre-packaged upgrade release provided by *Kühling&Kühling*, the user account running the RepRapOnRails software in the Linux operating system will be in default configuration. To change the password, use SSH on your computer connected to the same LAN as your 3D printer to log in to the BeagleBone Black. You can use the hostname in the printers' Backend-URL as its address and log in with the following access data:

User: kiosk Password: kiosk

Now you can set a new password by entering

passwd

and following the instructions. In delivery condition the unique password is an eight-digit combination from the serial number at the back of the device. Take the first two four-digit blocks (example: XX-AAAA-BBBB-CCCC-YYYY becomes an "AAAABBBB" password).

# Slicing

Any information we gather related to improving or easing the slicing process is listed in the following paragraphs.

#### Profile display problems in Slic3r for Windows

#### This bug will be fixed with the upcoming release of SLic3r v1.2.x.

It is a known problem that in Slic3r for Windows the drop-down lists for the profile selection are too narrow to display the full profile name. This can make it impossible to choose the correct profile when processing your slicing settings for creating a G-code.

		Sick	- 0
in Plate Neider Poly	Lations Analyziational		
manufactul shids a - 5	Distant conducts		
default - latting/illusting Testing	Beilige	at 200 pt 100 mm	
attingdiadday hplig	Print carries	a MJ 5/200 mm	
attingfilleddau Daglag mys farse	Zome	8	
pageotation shots good	Acres 1		
	R-sole favor	Replac dilatin/fprime:Repeter: +	
	the relative & detromat		
	Capitilito		
	Educion	1 0	
	Advanced		
	Dia fermani stradam	1 10	
	Tribution levels	2 10	

Narrow menus make it impossible to read the profile names in Slic3r v1.2.0 for Windows

Try the following to bypass the problem:

- Select a profile from the drop-down list and click the <save> symbol. This way, you make the profile name visible and editable.
- Delete the current profile name and replace it with a short description, e.g. "LEFT ONLY" instead of "Kuehling&Kuehling RepRap Industrial -LEFT EXTRUDER ONLY".
- The shorter description will be fully visible in the list.

Repeat these steps for all long profile names.

Kuehling&Kuehlin 🗧 🙀	Size and coordinates	
(D) Ceneral	Bed size:	x 200 y 180 mm
© Custom G-code	Print center:	m 00 y 90 mm
T Extruder 1	Zofftet:	a mm
	Firmware	
	operation and save prive	ter settings as:
	Capit	
	Extruders:	Abbrechen DK
	Advanced	
	Use firmware retractions	
	Vibration limit:	2 18
	TRADE AND AND A	1 N
+ - 0 Slicht		
	minter stations minter stations	
	ament Settings Printer Settings	
Kuehlingi.Kuehlin; 🗧 📓		
(Ceneral	Bed size:	x 200 y 100 mm
(i) Custom G-code	Print center:	x 100 y: 90 mm
T Extrader 1	Z offset:	9 mm
	Firmware	
	C-code Ravori 😐 Save	preset
		twr settings as:
	True Print	er tertings at:
	Capeb	Abbrechen DK
	Extruders:	Additional Disc
	Advanced	
	Use firmware retraction:	
	Vbration limit:	2 Hz
5		
52		
Plater Print Settings Fil	ament Settings Prinker SetLings	
-	Size and coordinates	
Plater Print Settings Fill	<ul> <li>Size and coordinates</li> <li>Bed size:</li> </ul>	x(200) y(100) zm
Plater Print Settings Fil	Size and coordinates     Bed size:     Print center:	x 1001 yc 9990 mm
Plater Print Settings Fill	<ul> <li>Size and coordinates</li> <li>Bed size:</li> </ul>	
Plater Print Settings Fill LIET ONDY :	Size and coordinates     Bed size:     Print center:	x 1001 y 1000 mm 000 mm
Plater Print Settings Fill LIET ONDY :	<ul> <li>Size and coordinates</li> <li>Bed size:</li> <li>Prink center:</li> <li>Z offset:</li> </ul>	x 1001 yc 9996 mm
Plater Print Settings Fill LIET ONDY :	Size and coordinates     Bed size:     Print center:     Z offset:     Firmware	x 1001 y 1000 mm 000 mm
Plater Print Settings Fill LIET ONDY :	Size and coordinates     Bed size:     Prior center:     Zoffnet:     Firmware     Goode Renor:     Use relative ( distances:	x 1001 y 1000 mm 000 mm
Plater Print Settings Fill LIET ONDY :	Size and coordinates     Bed size:     Print center:     Z offset:     Transvare     Groade Ranor:	x 1001 y 1000 mm 000 mm
Plater Print Settings Fill LIET ONDY :	Size and coordinates     Red size:     Prior contain:     Zoffast:     Firmware     Groade Ranon:     Use relative E distances:     Capabilities     Extrudens:	n (1007 y) (Hond ann 1006 - man Regnlar (Morfin/Sprinker/Wegnlar) +
Plater Print Settings Fill LIET ONDY :	Size and coordinates     Red size     Print constance     Zoffnet:     Prevance     Cooder Renor:     Use Induve & Existances:     Capublicies     Existances:     Advanced	x ( tor) y ( none was 000 mem Replus (Merin/Sprider/Repetier) x 1
Plater Print Settings Fill LIET ONDY :	Size and coordinates     Red size:     Prior contain:     Zoffast:     Firmware     Groade Ranon:     Use relative E distances:     Capabilities     Extrudens:	n (1007 y) (Hond ann 1006 - man Regnlar (Morfin/Sprinker/Wegnlar) +

## **Overhang - adjusting the layer thickness**

If you want to print filigree objects with overhanging structures without adding supports, try reducing the layer thickness for this print by 15 - 20%. This will result in a finer Z-axis resolution and increased overlay of subsequent layers so that more stability is gained over the height of the target object.

됩

### Modifying infill and perimeters

There are currently two Slic3r profiles available at our GitHub repository that provide preset ready-toprint slicing settings. Her are some tips for handling these profiles to adjust them to your needs. The *SOLID* profile normally needs no modification since it comes with stable, reliable settings for printing solid objects with 100 % infill.

The *ECO* profile supplies settings for objects with loosened infill. This makes objects lighter and reduces the print time and the material consumption. To achieve good results, the settings may have to be adjusted.

We recommend to set the following always for printing ECO objects:

- A hull thickness of 1.0 to 1.5 mm. As a rule of thumb divide the hull thickness by the nozzle tip diameter and set the amount of perimeters equal to the result. Such, a closed, smooth and stable hull is ensured.
- Honeycomb infill as it provides highest stability at optimal density.
- A minimum infill of 15 %.
- A maximum infill of 30 %. Increasing the infill further does not have a significant advantage compared to a solid body but strongly increases the printing time.

# Operation


In the following you will find more detailed descriptions of functions of the RepRap Industrial. In most cases, these are topics upraised by support requests or in-house lab experiments.

### **Print bed leveling**

The PEI print beds delivered with every RepRap Industrial are custom-made specially to our needs. Due to the manufacturing process, they may show bends and curves which can make handling them a bit tricky. These flaws are accepted due to the superior properties of PEI compared to other subsurfaces when printing ABS. Follow the tips given below and you should have no trouble achieving perfect results.

Of course, the PEI print bed is, like the whole RepRap Industrial, optimized for printing ABS. It also works fine with HIPS, PET-Copolyester, PVA and thermoplastic urethane (TPE-U). Other materials may require a different subsurface, be it another material or a special treatment with tape or glue. Find more information about materials and printing them with a RepRap Industrial in our Knowledgebase.

Accurate leveling is vitally important for the print result. Although correct first layer settings can compensate for slight unevennesses of the print bed, false leveling will ruin a print within the first few layers. Evidence for a leveling mistake can be:

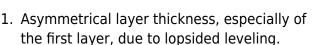

- On one side of the print bed the extruded strand is laid on the print bed instead of being spread → the print bed and the nozzle are too far apart.
- On the other side of the print bed the extruded strand is pressed onto the print bed until the nozzle tip is clogged → the print bed and the nozzle are too close.
- Smearing of the extrusion and possibly clogging of the nozzle due to too closely leveled bed.
- Strands do not stick to the print bed but are being pulled away by the nozzle tip. Of course, this can be due to a wrong bed temperature also – better double-check.
- 4. Extrusion of rounded, unjoined strands.

too close too far

Leveling mistakes: examples of characteristic appearances of the first layer.

following tips:


 Always make sure that the build chamber is adequately and uniformly preheated to at least 90 % of the target temperature (e.g. 63 °C for ABS).
 The Z-end stop is temperature sensitive and may cause deviating positioning when

exposed to temperature variations. Keep the build chamber doors as shortly open as possible during leveling to avoid too much heat loss.

- If you removed the print bed, always reinsert it in the same direction and orientation it had during leveling.
- Put the print bed with the convex side down onto the print table.
- After adjusting all three leveling points, return the print head to the first position (tap the [Back] button). Check the bed tip distance by tapping (not pressing) the print bed with a finger next to the nozzle tip: if you see a gap appearing at the slightest touch, the leveling point is correctly adjusted. If even the least pressure is required, the leveling is too high. Repeat this at the other two leveling points. Have a look at the adjacent videos for visual explanation.
- Before waisting time on unsuccessful leveling, please rethink if the currently installed nozzle tip is adequate for the print job. Wider nozzles are more tolerant when it comes to compensating leveling mistakes and may be more suited to the task, especially when printing larger parts.

#### **Tips for easier leveling**

If you find it difficult to adjust the three leveling points uniformly with only the spring pressure, place a sheet of paper (not more than standard 80 g/m<sup>2</sup>) between the nozzle tip and the print bed and carefully push the bed against the tip before fastening the set screws. This way, you ensure a uniform bed - tip distance at all three leveling points.

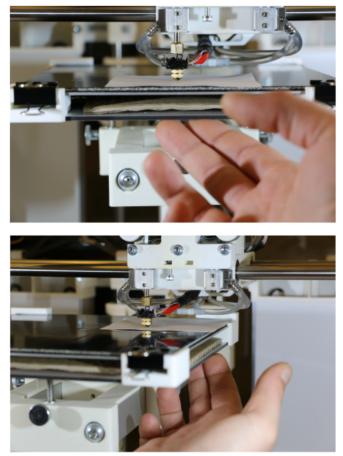

#### Ð

Manual leveling with paper spacer - front and hind right leveling point.

Another way of making leveling a little bit less important is "floating" your print on a raft. Slic3r (and most other slicing software) provides the "raft" function, a special kind of support material, which means that before starting with the actual object a (customizable) number of loosely printed layers is printed to compensate slight leveling mistakes. If you choose the raft settings correctly, beginning with a layer as wide and thick as allowable (depending on the nozzle tip's diameter) leveling will become a much less annoying process.

The raft's first layer is treated as the print's first the print. layer and uses the respective settings. The following layers of the raft are calculated according to the support material settings. Choose the maximal first layer height (*Slic3r*  $\rightarrow$ *Print Settings*  $\rightarrow$  *Layers and perimeters/First layer height*) and a first layer extrusion width of 250 % (*Slic3r*  $\rightarrow$  *Print Settings*  $\rightarrow$ *Advanced/Extrusion width -First layer*) for a compensating, condoning and stable raft. The raft can either be built of the model's material and cut away later or, if available for

OLID (modified) 🗄 🗎 🥥	Support material		
Layers and perimeters			
Infill     Overhang threshold:     Skirt and brim     Enforce support for the f		65	1
Support material	Enforce support for the first:	0	1 layers
Speed	Raft	-	
	Raft layers:	7	1 layers
Advanced Output options	L		
Notes	Options for support material	and raft	
	Contact Z distance:	0.2 (deta	achable) = mm
	Pattern	honeyco	+ dm
	Pattern spacing:	1.25	mm
	Pattern angle:	90	2 *
	Interface layers:	3	: layers
	Interface pattern spacing:	0.01	mm
	Don't support bridges:	2	

Adding a freely choosen number of raft layers to the print.

the specific plastic, of support material and broken off or dissolved. Check with the Materials' section to see if a secondary support material is available. For break-away or soluble rafts the dual extrusion function of the RepRap Industrial is required. Remember to check that all necessary calibrations and settings have been made as described in the Knowledgebase.

### Calibrating the extrusion

The stability and dimensional accuracy of any printed object require a correct amount of filament conveyed through the nozzle. Too little extrusion and the part will be thin-walled, fragile and likely to break. Too much material is likely to clog the nozzle and ruin the print. The amount of material effectively conveyed through the nozzle is depending on:

- the 3D printer itself slight variations are possible due to the manufacturing process;
- the actual filament diameter in the range of the dimensional stability of the filament;
- the printed material's properties the extruder drive wheel grinds deeper into softer materials, thus reducing the actual diameter;
- the idler tension high tension will cause the drive wheels teeth to grind deeply into the filament, causing a dilation of the material and a reduced output.

To make sure that the print result is stable and accurate, an *extrusion multiplier* must be found for every material on every apparatus; it may be that this factor must be found for every spool of filament.

The correct extrusion multiplier is set in the slicing software, compensating for the above named variables.

To find the correct multiplier, open the *Setup* menu at the GUI and choose [Calibrate Extrusion].

A detailed description for ABS filament can be found here.


For other materials, the same procedure applies but you have to prepare a G-code for the test print.

Idle		Emergency STOP
	t Control Log	
Wizards Print Bed Leveling United Filement Load Filement Prime Extraders	Nozzle Change Calibrate Extrusion Calibrate Extruder Offset	Web http://risidamorticks. http://risidamorticks. Software Venice: RegRay Endetting RegRay Endetting Microcontection Forward wenice: RepEter Firmeare v8.81-rri1.1.0-81
Left Extruder: 27.32 / 0 Right Extruder: 27.32 / statistics state income white color fabb.,x1	Chamber: 32.29 / 0 Bed: 60.29 / 60 Pretexting for Atto-PUTG built	Current / Target 10 Profile

Ð

Choose the [Calibrate Extrusion] wizard from the *Setup* menu (either software version).

To create a G-code for the extrusion calibration, you need an stl-file of a cube with the dimensions 30x30x15 mm (download here).

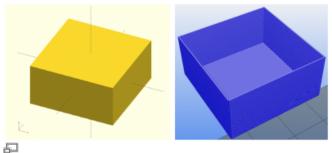

The 30x30x15 mm calibration cube as OpenSCAD model and ready sliced with Slic3r (view taken with Repetier-Host).

Plater Plate Strings Flamest Strings Platest Strings

Add... Defet a Defet All Artings Platest Strings


Add... Defet a Defet All Artings

Nore Power Africe Strings Extense. Scale... Solit View(Cot...String)


Rester View(Cot...String)

Re

Load the calibration cube stl-file in Slic3r.

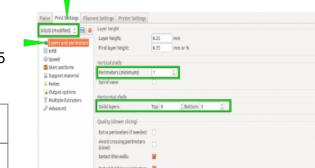

Select the *Layers and perimeters* according to the adjacent table.

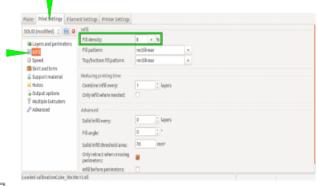

P

Select the *Infill* according to the adjacent table.

Plater Print Settings (His	meet Settings Printer Set	ings.	
calibrationCubels : + +		_	
Users and perimeter	Default extrusion width:	0.5	men or to (leave Orlar auto)
i udil.	100.000	15076	THE REPORT OF COMPANY
Thirt and brins	Perimeters:	0	men or % (leave Offer default)
ill Support material	External perimeters:	0	mm or % (leave this default)
G speed	INTE .	0	mm or % (leave Offer default)
T Multiple Extruders	solid infit:	0	mm or to (leave offer default)
Quint sotiers	Top solid infil:		mm-or N (leave Offer default)
d Notas	support material:	0	mm or m (leave ofter default)
	flow		
	thridge flow ratio:	1	
	Other		
	XV Size Compensation:		
	Threads:	2	

Load the stl-file in Slic3r and select the *Print Settings* tab.

Choose the *SOLID* profile as a basis.

Choose the following settings to make the cube a box without a lid and only one perimeter of 0.5 mm thickness for a wall:

Layers and Perimeters → Vertical shells Perimeters (minimum)	1
Layers and Perimeters $\rightarrow$ Horizontal shells Solid Layers TOP	0
Layers and Perimeters → Horizontal shells Solid Layers BOTTOM	3
Infill → Fill density	0 %
Advanced $\rightarrow$ Default extrusion width	0.5

Select the *Default extrusion width* according to the adjacent table.

INFO



Saving these settings as an "extruder calibration" profile will make this calibration much more comfortable in the future.

Upload the G-code to your 3D printer, print it, measure the wall thicknesses, and calculate the mean value.

Then open the [Calibrate Extrusion] wizard and enter the mean value.



Adjust the preset "0.50 mm" value via the touch buttons and read the necessary extrusion multiplier directly from the display.

The displayed extrusion multiplier can be entered in Slic3r (Filament settings) and saved in the filament profile.

Enter the extrusion multiplier in Slic3r and save the filament profile (rename!).

# Deactivating the heating elements after end of print job

Sometimes you may want to start a print job just before finishing time or the weekend. Since there is currently no automatic shutdown function, the 3D printer will then stay on all night respectively some days. With the following description you can alter the End G-code of your print so that the heating elements are shut off after the print job has been finished so that the power consumption is reduced significantly. A side effect is, that due to the fact that the build chamber needs some hours to channel off the heat the cooling process is slowed and thereby internal tensions of the printed object are reduced. To deactivate the heating elements after a print job:

• Open the [Printer Settings] tab in Slic3r and choose the *Custom G-code* menu.

- Activate the End G-code editor by clicking into the text field.
- Position the cursor in the last line before the ; /END-GCODE entry.
- Enter the command M104 S0 T2 This will set the heating elements of the build chamber to a temperature of 0 °C.
- Enter the command M140 S0 This will deactivate the print bed as the last action of the current G-code.

uehlingtKuehlin; 🚦 😐	Start G-code		
Di Ceneral O Custam Geode T Extruder 1	; START-GCODE NET AND G4 52 G90 G28	: activatio build chamber : wait 2 seconds : une absolute coordinates Thome all uses	
	End Goode GR 20 GR 20 H104 S3 T0 H111 S8 (JUND-GCODE Layer change G co	Lement mehrus kon divisene Themme all konse Low ministre estander heuter off (Sum ministre estander heuter off (Sum ministre estander heuter off ) such firmware debugievet	
	Tool change G-cod		

Switching off the build chamber heating elements by modifying the Slic3r custom End G-code.

#### Adjusting the build chamber temperature

#### NOTICE

The build chamber temperature is preset to the maximal permissible temperature of +70 °C at delivery.

*Exceeding* +70 °C will damage interior components of the RepRap Industrial such as stepper motors, bearings and electronics.

됩

Since hitherto the RepRap Industrial is the only commercially available Open Source 3D printer with an actively heated build chamber, common slicing software does not feature ambient temperature settings. For some materials, it is advantageous to modify the chamber temperature together with the other temperature settings. The build chamber's temperature of the RepRap Industrial is set via the "Start G-code" which can be manually altered. 

 9 Hater
 Printer Settings
 Printer Settings

 1
 LEFT EXTRUDER 0;
 Printer Settings

 1
 Corneral
 Printer Settings

 1
 Printer Settings
 Printer Setings

 1
 P

2

To change the build chamber temperature (in the following example we use our standard *Slic3r* - other software may differ in denotations):

- 1. Open your slicing software.
- 2. Open the tab "Printer Settings" and choose "Custom G-code".
- 3. Go to the line reading:

M104 S70 T2; set recirculating air heater to 70 degree celcius target temperature

Ð

Changing the build chamber temperature by modifying the Slic3r custom Start G-code.

 Change the entry "Sxy" (here S70) by replacing the value xy with the desired temperature, for example 50° C:

M104 S50 T2; set recirculating air heater to 50 degree celcius target temperature

(for logical reasons, the comment should be aligned)

5. If you want to keep the settings, save them in the profile (see Slic3r manual).

Any G-code exported with this profile loaded will heat the build chamber to the stated temperature prior to printing.

### G-code manipulation at the GUI

The following list contains supported G-code commands that can be used on demand to directly interfere with a print procedure or setting via the G-code keyboard of the GUI's **Log** menu.



日

The G-code keyboard in the Log menu provides all keys to enter G-code commands.

Command	Effect	Example
G1	Coordinated Movement X Y Z E	G1 X130 Y85 Z1.75 E4.35
G4 S <seconds></seconds>	Wait for given duration in seconds	G4 S5 (waits 5 seconds)
G28	Home all axes	
G90	Use absolute coordinates	
G91	Use relative coordinates	
M80	Activate build chamber	
M82	Set E codes absolute (default)	
M83	Set E codes relative while in Absolute Coordinates (G90) mode	
M104 S <temp> T<extruder></extruder></temp>	Set temperature without wait	Adjusting the build chamber temperature, Deactivating the heating elements after end of print job
M109 S <temp> T<extruder></extruder></temp>	Set temperature with wait	

Command	Effect	Example	
M140 S <temp></temp>	Set bed target temp without wait		
M190 S <temp></temp>	Set bed target temp with wait		
M221 S <extrusion flow<br="">multiplier in percent&gt;</extrusion>	Increase/decrease given flow rate	M221 S95 → decrease flow to 95 % of g-code value	
M220 S <print speed<br="">multiplier in percent&gt;</print>	Increase/decrease print speed of all drive speeds	M220 S95 $\rightarrow$ decrease print speed to 95 % of g-code value	